



SAN FRANCISCO PLANNING DEPARTMENT

Article 11 Initiation Case Report

Conservation District Designation

HEARING DATE: MARCH 21, 2018

Case No. 2017-010156DES
Project: Mint-Mission Conservation District
Re: Initiation of Conservation District Designation
Staff Contact: Frances McMillen (415) 575-907
frances.mcmillen@sfgov.org
Reviewed By: Tim Frye – (415) 575-6822
tim.frye@sfgov.org

1650 Mission St.
Suite 400
San Francisco,
CA 94103-2479

Reception:
415.558.6378

Fax:
415.558.6409

Planning
Information:
415.558.6377

PROJECT DESCRIPTION

The case before the Historic Preservation Commission is initiation and recommendation to the San Francisco Board of Supervisors the Designation of the Mint-Mission Conservation District pursuant to Section 1107 of the Planning Code.

BACKGROUND

The Central SoMa Historic Resources Survey (2013-2014) determined numerous properties as eligible for Article 11 designation. These include the nineteen significant or contributing properties located within the proposed Mint-Mission Conservation District. The Planning Department (Department) conducted the survey in order to provide information on the location and distribution of resources within the Central SoMa Plan Area for the purposes of long-range policy planning and for use in permit processing, environmental review, and making recommendations for official nominations to historic registers. In conjunction with the survey, the Department developed the Central SoMa Historic Context Statement (2015) in order to provide a framework for consistent, informed evaluations of the area's age-eligible properties that had not been previously surveyed or for which survey information was incomplete.

- The Central SoMa Plan Area is comprised of approximately 28 blocks bounded by Market Street to the north, Townsend Street to the south, Second Street to the east, and Sixth Street to the west.
- The Central SoMa Historic Survey examined a total of 134 parcels within the Central SoMa Plan area that had not been previously surveyed, or for which prior survey information was incomplete. Of these, 72 parcels were not documented, typically because the properties were vacant or not age eligible. A total of 31 properties were determined eligible for the California Register.
- Based on the findings of the historic context statement and surveys, the Central SoMa Plan recommends policies that would recognize and protect historic resources. Such policies include protecting Significant and Contributory cultural heritage properties through designation to Article 11 of the Planning Code.

- The Historic Preservation Commission adopted the survey and historic context statement for the Central SoMa Plan on March 16, 2016.

ENVIRONMENTAL REVIEW STATUS

The Planning Department has determined that actions by regulatory agencies for protection of the environment (specifically in this case, Article 11 designation) are exempt from environmental review, pursuant to CEQA Guidelines Section 15308 (Class Eight - Categorical).

REQUIRED COMMISSION ACTIONS

The items before the Historic Preservation Commission are:

- 1) Consideration of initiation of designation the Mint-Mission Conservation District.

On this item, the HPC may choose to take an action in the form of a resolution. The HPC may approve, modify, or disapprove the initiation of the proposed conservation district designation.

Alternatively, the Commission may request additional research and information from the Planning Department to justify any of these three actions, and may continue the discussion to a future hearing pending submittal of any additional information the Commission may require.

OTHER ACTIONS REQUIRED

If the Historic Preservation Commission (HPC) decides to initiate the Designation of the Mint-Mission Conservation District under Article 11 at the March 21, 2018 hearing, the case will be brought back to the HPC at a future hearing. At such future hearing, the HPC shall consider and have opportunity to act upon the Designation of the conservation district and shall forward that recommendation to the Board of Supervisors.

PREVIOUS ACTIONS

The Historic Preservation Commission adopted the Central SoMa survey and historic context statement for the Central SoMa Plan on March 16, 2016.

Central SoMa Historic Context Statement

The Central SoMa Historic Context Statement was developed as part of the Central SoMa Plan effort to provide a historical foundation and framework for consistent evaluations of the area's age-eligible properties. The context statement's study area extended beyond the boundaries of the Central SoMa Plan Area and documented the history of SoMa, including significant themes, design elements, architectural styles, and character-defining features. The study developed significance and integrity thresholds and included analysis of conservation, landmark and historic districts and their relationship to previously undocumented buildings.

Central SoMa Survey

The Central SoMa Historic Resource Survey (2013-2014) involved gathering baseline property information for all buildings located within the Central SoMa Plan Area that had not been addressed by prior historic resources surveys, and those that had not been previously assigned California Historic Resource Status Codes (CHRSC). The Central SoMa Historic Survey examined a total of 134 parcels within the Central SoMa Plan Area. Of these, 72 parcels were not documented, typically because the properties were vacant or not age eligible. A total of 31 properties were determined eligible for the California Register.

APPLICABLE PRESERVATION STANDARDS

ARTICLE 11 – Conservation Districts

Planning Code Section 1107 authorizes the designation or boundary change of a Conservation District through amendment of Section 1103.1 of Article 11 if they contain “...substantial concentrations of buildings that together create subareas of special architectural and aesthetic importance” (Section 1103). The designation of an area of the C-3 District as a Conservation District or the change of District boundaries may be initiated by motion of the Board of Supervisors, by resolution of the Planning Commission or the Historic Preservation Commission, by application of the owners of greater than 25 percent of the structures in the area proposed for designation, or by any historic preservation organization or group, or upon the verified application of at least 150 registered voters of the City. Once initiated, the proposed designation is referred to the Planning Commission for review and comment on the designation or boundary change of a Conservation District.

If the Historic Preservation Commission approves the designation or boundary change, a copy of the resolution of approval is transmitted to the Board of Supervisors, which holds a public hearing on the designation and may approve, modify or disapprove the designation or boundary change (Section 1107(d)). If the Historic Preservation Commission disapproves the proposed designation or boundary change, such action shall be final, except upon the filing of a valid appeal.

ARTICLE 11 – Designation of Buildings

Planning Code Section 1106 authorizes the designation or change of designation of a building through amendment of Appendices A, B, C and D of Article 11. Such designation or change of designation of a building may be initiated by motion of the Board of Supervisors, by resolution of the Planning Commission or the Historic Preservation Commission [former Landmarks Preservation Advisory Board], by application of the owner of the affected property, or by application of any historic preservation organization or group, or by the application of at least 50 registered voters of the City.

If the Historic Preservation Commission approves the designation, a copy of the resolution of approval is transmitted to the Board of Supervisors, which holds a public hearing on the designation and may approve, modify or disapprove the designation (Section 1106(d)). If the Historic Preservation Commission disapproves the proposed designation, such action shall be final, except upon the filing of a valid appeal.

Pursuant to Planning Code Section 1106(h), the designation of a building may be changed if changes in Conservation District boundaries warrant such reclassification, or if physical changes to the building

warrant such reclassification, or if due to passage of time, the building has become at least 40 years old and, therefore, eligible for reclassification, or if new information makes the building eligible for reclassification.

OWNER NOTIFICATION AND COMMUNITY OUTREACH

The following includes a timeline of the notifications, announcements, and outreach activities that have occurred for the Central SoMa Plan.

- **The Central SoMa Historic Resources Survey web page** was launched on the Department's website in March 2014. The web page includes links to the draft Central SoMa Historic Context Statement, as well as a map illustrating the draft findings of the Central SoMa Historic Resources Survey. The website remains active and can be accessed at: <http://www.sf-planning.org/index.aspx?page=3964>.
- **Public outreach meetings** were held at the SPUR Urban Center on March 25th, 2015, to present the draft Central SoMa Historic Context Statement and the draft findings of the Central SoMa Historic Resources Survey. In preparation for this meeting, postcards were mailed to the owners of surveyed properties informing them that the draft survey findings were available for review on the project website, and inviting them to attend the outreach meeting at the Spur Urban Center. A second public meeting at the SPUR Urban Center was held on December 9, 2015 to solicit feedback on public benefits, including historic preservation. A postcard was mailed to public on February 29, 2016 in anticipation of the adoption hearing on March 16, 2016.
- **Presentation to SF Heritage** regarding the draft historic context statement and survey findings in July 2015.
- **Meetings with the Central SoMa Survey Advisory Group** were held on October 3, 2014 and January 15, 2014, the purpose of these meetings was to solicit comments and suggestions based on the draft *Central SoMa Historic Context Statement* and the draft findings of the Central SoMa Historic Resources Survey.
- **Notification of Historic Preservation Commission initiation hearing** was mailed to property owners on March 1, 2018.

PUBLIC COMMENT

Since hearing notice was mailed out, the Department has one inquiry from a property owner with general questions regarding Article 11 Conservation District designation.

STAFF ANALYSIS

The Mint Mission Conservation District is representative of the post-1906 San Francisco earthquake and fire reconstruction period and the evolution of land use patterns at the northern edge of the South of Market neighborhood dating to the mid-nineteenth century. The district embodies the historic function of the blocks immediately south of Market Street as a transition zone between the large-scale commercial

uses along Market Street and the predominately industrial uses to the south. This land use pattern was replicated during the reconstruction of South of Market following the 1906 earthquake and fire.

The district retains a mix of small to mid-scale residential, commercial and industrial buildings reflective of SoMa's role as the center of industrial production in San Francisco and the major supplier of mining equipment, heavy machinery and other goods to the western states during the mid-nineteenth century. Constructed between 1906 and 1930, the district's buildings include several warehouses and industrial lofts, three residential hotels with commercial ground floors, and a former bank. Residential hotels provided housing for the largely single men employed by the nearby factories and manufacturing operations and in seasonal or temporary positions along the waterfront. The district is particularly notable as it is a survivor of the extensive redevelopment of SoMa in the late twentieth century during which much of the building stock from the period when the neighborhood served as the city's industrial and manufacturing center was razed.

The district encompasses a cohesive concentration of reinforced concrete and brick masonry buildings featuring Classical Revival style design influences. The use of Classical design elements, more so than any other style, typified early 20th century commercial architecture in San Francisco. Common examples of Classical Revival design include the use of corniced rooflines, frequently with brackets or modillions; dentil moldings; applied cast shield or swag ornaments; and arched openings. These design details are frequently strongest on residential and mixed-use buildings, and less pronounced on industrial buildings.

Other than portions of the New Montgomery-Mission-Second Street Conservation District, there are no other blocks north of Howard Street or east of 6th Street which so strongly retain this historic mix of residential hotels, small-scale commercial buildings, warehouses and manufacturing facilities. The Mint-Mission district is also rare in that most buildings are constructed on through-lots and have visible rear elevations.

RECOMMENDATION

The Department recommends that the HPC adopt a resolution to initiate designation of the Mint-Mission Conservation District. Documentation to support the proposed conservation district is included in Appendices A and D.

BASIS FOR RECOMMENDATION

- The designation of the district meets the eligibility requirements for listing on both the California Register of Historical Places and as a San Francisco Article 11 Conservation District.
- The proposed district contains 19 Significant or Contributory Buildings which possesses substantial overall architectural, aesthetic or historic qualities justifying additional controls to protect and promote those qualities as required in Planning Code Section 1103.
- The creation of the Mint-Mission Conservation District advances the basic principles of the Downtown Plan and reinforces the unique sense of place provided by the Conservation District. The Downtown Plan of the San Francisco General Plan contains the following relevant objectives and policies:

OBJECTIVE 12: Conserve resources that provide continuity with San Francisco's past.

POLICY 12.1: Preserve notable landmarks and areas of historic, architectural, or aesthetic value, and promote the preservation of other buildings and features that provide continuity with past development.

POLICY 12.2: Use care in remodeling significant older buildings to enhance rather than weaken their original character.

- The properties proposed for designation advance the basic principles and objectives of the Central SoMa Plan. The Central SoMa Plan contains the following relevant objectives and policies:

OBJECTIVE 7.2: Support the preservation, recognition, and wellbeing of the neighborhood's cultural heritage resources.

OBJECTIVE 7.3.2: Support the preservation of buildings and features that reflect the industrial and arts legacy of the neighborhood.

OBJECTIVE 7.4: Prevent demolition of or insensitive alterations to cultural heritage resources in the built environment.

OBJECTIVE 7.4.2: Protect "Significant" and "Contributory" cultural heritage properties through designation to Article 11 of the Planning Code.

ATTACHMENTS

Appendix A: Appendix K to Article 11 Mint-Mission Conservation District

Appendix B: Map of Mint-Mission Conservation District

Appendix C: Draft Resolution to Initiate Designation of Article 11 Conservation District

Appendix D: Department of Parks and Recreation (DPR) 523 forms

MARKET ST

STEVENSON ST

JESSIE ST

6TH ST

MINNA ST

NATOMA ST

MARY ST

MINT ST

MINT PLZ

MISSION ST

5TH ST



MARKET ST

STEVENSON ST

JESSIE ST

6TH ST

MINNA ST

NATOMA ST

MARY ST

MINT ST

MINT PLZ

MISSION ST

5TH ST



3704059

3704035

3704034

3704010

3704113

3704144

3704079

3704003

3704024

3704022

3704021

3704020

3704019

3704028

3704018

3704029

3704017

3704013

3704012

3725087

3725088



SAN FRANCISCO PLANNING DEPARTMENT

Historic Preservation Commission Resolution No. ***

HEARING DATE: MARCH 21, 2018

Case No. 2017-010156DES
Project: Mint Mission Conservation District
Re: Initiation of Article 11 Conservation District Designation
Staff Contact: Frances McMillen (415) 575-907
frances.mcmillen@sfgov.org
Reviewed By: Tim Frye – (415) 575-6822
tim.frye@sfgov.org

1650 Mission St.
Suite 400
San Francisco,
CA 94103-2479

Reception:
415.558.6378

Fax:
415.558.6409

Planning
Information:
415.558.6377

RESOLUTION TO INITIATE DESIGNATION OF THE MINT MISSION CONSERVATION DISTRICT ASSESSOR'S PARCEL NO. 3704 LOTS 003, 010, 012, 013, 017, 018, 019, 020, 021, 022, 024, 028, 029, 034, 035, 059, 079, 113, 144, AND ASSESSOR'S PARCEL NO. 3725 LOTS 087, 088 PURSUANT TO ARTICLE 11 OF THE PLANNING CODE.

1. WHEREAS, on August 17, 2016, the Historic Preservation Commission added the Mint Mission Conservation District, Assessor's Parcel No. 3704, Lots 003, 010, 012, 013, 017, 018, 019, 020, 021, 022, 024, 028, 029, 034, 035, 059, 079, 113, 144, and Assessor's Parcel No. 3725, Lots 087, 088, to its Landmark Designation Work Program; and
2. WHEREAS, Planning Department staff Frances McMillen, who meets the Secretary of Interior's Professional Qualification Standards, prepared the draft Conservation District Case Report, which was reviewed by Department staff Tim Frye for accuracy and conformance with the purposes and standards of Article 11; and
3. WHEREAS, the Historic Preservation Commission, at its regular meeting of March 21, 2018 reviewed Department staff's analysis of the Mint Mission Conservation District, Assessor's Parcel No. 3704, Lots 003, 010, 012, 013, 017, 018, 019, 020, 021, 022, 024, 028, 029, 034, 035, 059, 079, 113, 144, and Assessor's Parcel No. 3725, Lots 087, 088, historical significance per Article 11 as part of the Conservation District Case Report dated March 21, 2018 and
4. WHEREAS, the Central SoMa Survey determined Mint Mission Conservation District, Mint Mission Conservation District, Assessor's Parcel No. 3704, Lots 003, 010, 012, 013, 017, 018, 019, 020, 021, 022, 024, 028, 029, 034, 035, 059, 079, 113, 144, and Assessor's Parcel No. 3725, Lots 087, 088, is eligible for listing on the California Register of Historical Resources and is representative of the post-1906 San Francisco earthquake and fire reconstruction period and the evolution of land use patterns at the northern edge of the South of Market neighborhood dating to the mid-

nineteenth century. The district is a rare and cohesive concentration of reinforced concrete and brick masonry buildings featuring Classical Revival style design influences; and

5. WHEREAS, the Historic Preservation Commission finds that the Mint Mission Conservation District, Assessor's Parcel No. 3704, Lots 003, 010, 012, 013, 017, 018, 019, 020, 021, 022, 024, 028, 029, 034, 035, 059, 079, 113, 144, and Assessor's Parcel No. 3725, Lots 087, 088, Case Report is in the form prescribed by the Commission and contains supporting historic, architectural, and/or cultural documentation; and

THEREFORE BE IT RESOLVED, that the Historic Preservation Commission hereby initiates conservation district designation of the Mint Mission Conservation District Assessor's Parcel No. 3704, Lots 003, 010, 012, 013, 017, 018, 019, 020, 021, 022, 024, 028, 029, 034, 035, 059, 079, 113, 144, and Assessor's Parcel No. 3725, Lots 087, 088, pursuant to Article 11 of the Planning Code.

I hereby certify that the foregoing Resolution was adopted by the Historic Preservation Commission at its meeting on March 21, 2018.

Jonas P. Ionin
Commission Secretary

AYES:

NAYS:

ABSENT:

ADOPTED:

State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code 5S3
Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 4 *Resource name(s) or number (assigned by recorder) 3704003, 40-48 5th Street

P1. Other Identifier

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 40-48 5th Street

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone ____; ____mE/ ____mN

e. Other Locational Data: Assessor's Parcel Number: 3704003

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

40-48 5th Street is a five-story, rectangular-plan, brick masonry, Edwardian style commercial and hotel building that is clad with brick and topped by a flat roof. The building occupies the entirety of its 3,746 square foot lot on the west corner of 5th and Jessie streets. The primary facade faces northeast onto 5th Street and features the hotel entrance at the center of the first story. The entrance is deeply recessed and features a set of fully-glazed, wood double doors. On either side of the entrance are storefronts. On the right is a large plate-glass display window and a fully-glazed, aluminum-frame pedestrian door. On the right, the storefront is clad with marble panels and features large plate glass display windows with a recessed fully-glazed, metal-frame entry door at the center. The east corner of the building is angled and features a plate glass display window. The hotel entry and storefronts are surmounted by fabric awnings and a dentiled intermediate cornice. The second through fifth stories are each separated by molded stringcourses and feature three pairs of one-over-one, double-hung, wood-sash windows each. On the second through fourth stories the center pair of windows are relatively unadorned, being topped by brick jack arches, and provide access to a fire escape with decorative wrought iron railings. (continued)

*P3b. Resource Attributes: (list attributes and codes) HP5. Hotel/motel

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of southeast and northeast facades. 103_4039.JPG 3/7/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both

1907, Assessor's Office

*P7. Owner and Address:

Oakwood Hotel Llc
40-48 5th St
San Francisco Ca
94103

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/7/2011

*P10. Survey Type: (Describe)

Intensive



*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

☒ BSOR ☒ Photograph Record ☐ Sketch Map
☐ Archaeological Record ☐ NONE ☐ Location Map ☒ Continuation Sheet ☐ Other...
☐ Artifact Record ☐ District Record ☐ Linear Feature Record

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 2 of 4

Resource Name or # (Assigned by Recorder) 3704003, 40-48 5th Street

*Recorded by: Tim Kelley Consulting

Date 3/7/2011

☒ Continuation ☐ Update

P3a: Description (continued)

The pairs of windows flanking the center pair have elaborate surrounds incorporating square pilasters, foliate wall panels, paneled Ionic colonettes, decorative moldings, and scrolled cartouches. The windows on the fifth story are all surmounted by brick jack arches and do not have elaborate surrounds. The facade terminates in a modillioned cornice and flat roofline. The east corner of the building features an angled bay window that extends from the second through fifth story. It is decorated in a similar fashion to the window surrounds described previously, with square pilasters, foliate and gothic tracery wall panels, paneled Ionic colonettes, decorative moldings, and scrolled cartouches.

The southeast facade is very similar to the northeast facade. The left side of the first story is clad with brick and features two pedestrian entrances covered by metal security gates. The right side continues the marble-clad storefront from the left side of the northeast facade and features an additional recessed entrance with a fully-glazed, aluminum-frame door. The intermediate cornice, string courses, and cornice continue from the northeast facade and the fenestration patterns of the upper stories are similar. Each story features five pairs of one-over-one, double-hung, wood-sash windows, all with the decorative surrounds seen previously, except for those on the fifth story, which are surmounted by brick jack arches. At the right end of each story there are also two individual windows; one smaller than the others and one of standard size. These windows are surmounted by brick jack arches and do not have decorative surrounds.

The northwest and southwest facades abut neighboring buildings and are not visible. The building appears to be in good condition.

Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



BUILDING, STRUCTURE, AND OBJECT RECORD

*NRHP Status Code 5S3

Page 4 of 4

*Resource Name or # (Assigned by recorder) 3704003, 40-48 5th Street

B1. Historic Name Oakwood Hotel

B2. Common Name Oakwood Hotel

B3. Original Use Hotel

B4. Present Use: Residential

***B5. Architectural Style**

***B6. Construction History**

Constructed 1907.

*B7. Moved? ☒ No ☐ Yes

Date? _____

Original Location: _____

*B8. Related Features None.

B9a. Architect McDougall Brothers

*B10. Significance: Theme Social and Cultural
Development; Creating the New

Area: _____

Period of Significance 1870-1930 Property Type Residential Applicable Criteria A, C

(Discuss importance in terms of historical or architectural context as defined by theme, period, and geographic scope. Also address integrity)

40-48 5th Street was designed by architecture firm McDougall Brothers, who also designed three Carnegie libraries, several public buildings in the Central Valley, and the Oakland federal building. Partner George McDougall was the State Architect from 1913 through 1938. The building housed the Oakwood Hotel, one of many residential hotels in the Mid-Market survey area serving both short term guests and long-term residents who were also employed in the area, including laborers, clerks, and those employed in the nearby theaters and restaurants.

40-48 5th Street retains integrity. Its original plan, massing, facade organization, materials and ornamentation are intact. The first story storefronts appear to have been altered, but this a common and readily conceded alteration throughout the city. In general the building's original appearance is discernible.

B11. Additional Resource Attributes: (List attributes and codes) HP5. Hotel/motel

***B12. References:**

(Sketch Map with north arrow required.)

B13. Remarks

*B14. Evaluator Tim Kelley Consulting

*Date of Evaluation 3/7/2011

(This space reserved for official comments)



State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code 6Z

Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 2 *Resource name(s) or number (assigned by recorder) 3704010, 426 Jessie Street

P1. Other Identifier 12 Mint Plaza
*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 426 Jessie Street

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone ____; ____ mE/ ____ mN

e. Other Locational Data: Assessor's Parcel Number: 3704010

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

426 Jessie Street is a two-story, rectangular-plan, brick masonry, utilitarian style commercial building that is clad with yellow marble tiles and topped by a flat roof. The building occupies the entirety of its 1,873 square foot lot on the northwest side of Jessie Street (aka Mint Plaza) southwest of 5th Street. The primary facade faces southeast onto Jessie Street and is two bays wide. On the first story, the left bay features a fixed, anodized aluminum-sash storefront window consisting of a large fixed lite topped by a row of three small lites. The right bay is recessed and contains the primary entrance and a wall-mounted ATM machine. The entrance consists of a fully-glazed, anodized aluminum-frame, pedestrian door. The second story features two windows; fixed, multi-lite, anodized aluminum-sashes with three small lites topped by three larger lites. The facade terminates in a simple wood or metal coping. The secondary facades abut neighboring buildings and are not visible. The building appears to be in good condition.

*P3b. Resource Attributes: (list attributes and codes) HP6. 1-3 story commercial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of southeast facade.
103_4049.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both

1919, Assessor's Office

*P7. Owner and Address:

Sf Newspaper Federal Credit
% Oleg V Vishnevsky
426 Jessie St
San Francisco Ca 94103

*P8. Recorded by


Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive

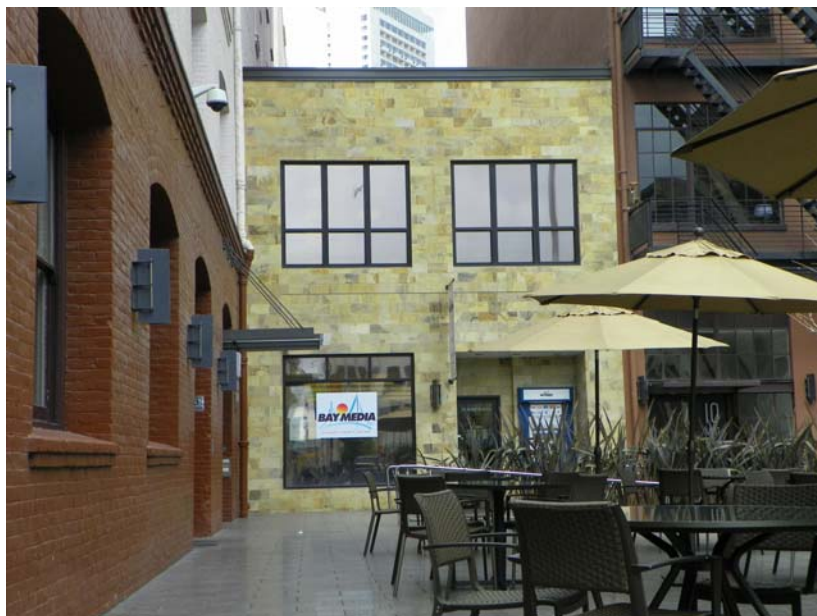

*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

☒ BSOR ☐ Photograph Record ☐ Sketch Map
☐ Archaeological Record ☐ NONE ☐ Location Map ☐ Continuation Sheet ☐ Other...
☐ Artifact Record ☐ District Record ☐ Linear Feature Record

BUILDING, STRUCTURE, AND OBJECT RECORD

Page 2 of 2 *NRHP Status Code 6Z
*Resource Name or # (Assigned by recorder) 3704010, 426 Jessie Street

B1. Historic Name None

B2. Common Name None

B3. Original Use warehouse B4. Present Use: Commercial

*B5. Architectural Style _____

*B6. Construction History

Constructed 1919.

*B7. Moved? ☐ No ☐ Yes

Date? _____

Original Location: _____

*B8. Related Features None.

B9a. Architect Unknown

*B10. Significance: Theme NA Area: _____

Period of Significance NA Property Type Commercial Applicable Criteria NA

(Discuss importance in terms of historical or architectural context as defined by theme, period, and geographic scope. Also address integrity)

426 Jessie Street is not associated with significant events or persons important to the survey area. In addition, the building does not appear to be architecturally significant according to California Register criteria. The building does not embody the distinctive characteristics of a type, period, or method of construction, or possess high artistic value, and does not appear to be the work of a master. Additionally, 426 Jessie Street lacks integrity. Its original plan and massing appear to be intact, but the facade has been recently remodeled with new yellow stone tile cladding and anodized aluminum fenestration. It was likely clad with brick and concrete originally, and later with flagstone veneer. It previously had aluminum windows of a different configuration than currently and the entrance was located on the left side of the facade and has since been shifted to the right side and recessed. Although the building was likely not very ornamental originally, it had brick piers that divided the facade into two bays and projected above the roofline, features that are now absent. It is therefore not eligible for the California Register under any criteria.

B11. Additional Resource Attributes: (List attributes and codes) HP6. 1-3 story commercial building

*B12. References:

(Sketch Map with north arrow required.)

B13. Remarks

*B14. Evaluator Tim Kelley Consulting

*Date of Evaluation 3/8/2011

(This space reserved for official comments)



PRIMARY RECORD

Primary # _____

HRI # _____

Trinomial _____

NRHP Status Code 3S

Other Listings LOCAL: Category I in Article 11

Review Code _____

Reviewer _____

Date _____

Page 1 of 4

*Resource name(s) or number (assigned by recorder) 3704012, 66 Mint Street

P1. Other Identifier Bank/ Remedial Loan

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad: _____

Date: _____

*c. Address: 66 Mint Street

City: San Francisco

Zip: 94103

d. UTM: (Give more than one of large and/or linear resources) Zone _____; _____mE/ _____mN

e. Other Locational Data: Assessor's Parcel Number: 3704012

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

This two-story commercial building is rectangular in plan, appearing to contain a double-height commercial space at ground level and a single-height office space on the second story. The exterior features a prominent arcade composition with fixed and pivot sash glazing; low-relief sculptural panels just below the spring line of each arch bay divides the glazing into a 12-lite rectangular panel at ground level and an eight-lite lunette at the second story. Cladding materials appear to include a heavy glazed terra cotta at the facade's base with imitation sandstone above. The cornice features an inscribed fascia, triglyphs, dentils, and a low, unarticulated parapet above. This building was designed in 1916 by Frederick Whitton for the Remedial Loan Bank, where those owing money to 'loan sharks' could procure legitimate loans at reasonable interest rates. It is designated the highest category of the Downtown Plan (Category I in Article 11 of the Planning Code). This building may become eligible for the National Register of Historic Places when more is known about the building.

*P3b. Resource Attributes: (list attributes and codes) HP6. 1-3 story commercial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #
?)

*P6. Date Constructed/Age and Sources

☒ Historic ☐ Prehistoric ☐ Both

1916

per San Francisco

Architectural Heritage

*P7. Owner and Address:

Remedial Building Co.

54 Mint St, 5th Floor

San Francisco, Ca 94103

*P8. Recorded by

Anne Bloomfield

2229 Webster Street

San Francisco, CA 94115

*P9. Date Recorded:

06/06/01

*P10. Survey Type: (Describe)

*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

☒ BSOR

☒ Photograph Record

☐ Sketch Map

☐ Archaeological Record ☐ NONE

☐ Location Map

☒ Continuation Sheet ☐ Other...

☐ Artifact Record

☐ District Record

☐ Linear Feature Record

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 2 of 4 Resource Name or # (Assigned by Recorder) 3704012, 66 Mint Street

*Recorded by: Anne Bloomfield

Date 06/06/01

☒ Continuation ☐ Update

Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



Mission Street and Mint Plaza facades.
3/8/2011. 103_4068.JPG



Mission Street facade. 3/8/2011. 103_4069.
JPG

BUILDING, STRUCTURE, AND OBJECT RECORD

*NRHP Status Code 3S

Page 3 of 4

*Resource Name or # (Assigned by recorder) 3704012, 66 Mint Street

B1. Historic Name San Francisco Remedial Loan Association

B2. Common Name San Francisco Provident Loan Association

B3. Original Use Commercial; financial B4. Present Use: Commercial; financial

*B5. Architectural Style Classical Revival

*B6. Construction History

Built in 1916. Remodeled in 1940.

*B7. Moved? ☒ No ☐ Yes

Date? N/A

Original Location: N/A

*B8. Related Features None.

B9a. Architect Frederick Whitton

Unknown

*B10. Significance: Theme Commercial Development

Area: Mid-Market

Period of Significance 1916-1951

Property Type Commercial

Applicable Criteria A, C

(Discuss importance in terms of historical or architectural context as defined by theme, period, and geographic scope. Also address integrity)

66 Mint Street was designed in 1916 by architect Frederick Whitton for the San Francisco Remedial Loan Association. The bank was originally located at 43 5th Street and presumably moved to the nearby subject property in 1916. The business was based closely on the Provident Loan Society in New York (established 1893), including the appearance of its Classical Revival style building.

In December 1912, the San Francisco Remedial Loan Association was founded in an effort to provide working class people with a source for safe, professional, accessible collateral loans from a legitimate institution rather than the neighborhood loan shark. (continued)

B11. Additional Resource Attributes: (List attributes and codes) HP6. 1-3 story commercial building

*B12. References: Architect & Engineer, 1912, 1919.

"Eureka Inn," http://en.wikipedia.org/wiki/Eureka_Inn

"New Company Deals Blow at Loan Sharks," SF Call, 13 Dec 1912.

(continued)

(Sketch Map with north arrow required.)

B13. Remarks

*B14. Evaluator Tim Kelley Consulting

*Date of Evaluation 6/20/2011

(This space reserved for official comments)



CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 4 of 4

Resource Name or # (Assigned by Recorder) 3704012, 66 Mint Street

*Recorded by: Anne Bloomfield

Date 06/06/01

☒ Continuation ☐ Update

B10: Significance (continued)

The Remedial Loan Association allowed customers to provide any piece of property acceptable at a pawn shop as collateral for monetary loans, on which 1 1/2 to 2 percent interest was charged per month. (Loan Sharks were notorious for charging 10 to 20 percent.) The business was run by a board of directors and supported by the prominent financial, commercial and philanthropic concerns that they were involved in. Although it was run as a private business, it was not a money-making concern. Instead, dividends were limited to six percent and annual overages were donated to charity.

The 1949 Sanborn map notes that the building was "built 1916 & 1940," suggesting that it may have undergone a major remodel in 1940. In 1951, the business was sold by the original board of directors, became family-owned and operated, and the name was changed to San Francisco Provident Loan Association. As an offshoot of the collateral aspect of their lending scheme, the company began dealing in the buying and selling of jewelry as well. It still operates at 66 Mint Street today.

Architect Frederick Whitton, who designed 66 Mint Street, worked for well-known Bay Area architect Willis Polk in 1912 and later had his own practice in the Exchange Block building at 369 Pine Street (which he designed in 1918). In addition to the San Francisco Remedial Loan Association bank, which appears to be one of his earlier independent works, he is known to have designed buildings throughout Northern California, including the Weinstock-Lubin department store in Sacramento (1919); the Eureka Inn in Eureka, CA (1922, NRHP listed); Hotel Petaluma in Petaluma, CA (1923); and the Santa Barbara Telephone Building in Santa Barbara, CA (1927). Before becoming an architect, Whitton was a teacher, which served him well in his role as advisory architect for the Sacramento School Board around 1920.

Previous evaluation (Bloomfield, 2001) stated that "this building may become eligible for the National Register of Historic Places when more is known about the building." Based on the findings above, 66 Mint Street appears to be eligible for the National Register of Historic Places under criteria A and C. The building has associations with important events, namely the activities of the San Francisco Remedial Loan Association, which was one of the first financial institutions in San Francisco to improve the personal finances of the working class and eliminate the threat of loan sharks. Although the Loan Association was not founded in this location, its original offices no longer exist and 66 Mint Street serves as the best and most well-known location for the business. Additionally, the building is notable for its excellent Classical Revival architecture, which nicely exemplifies trends in banking temple aesthetics, thus expressing its status as a financial institution. The building was designed by Frederick Whitton, who was a respected architect in Northern California with a number of prominent buildings to his name, including one that is listed on the National Register for its architectural merit. 66 Mint Street has good integrity, with only minor compatible changes to its entrances, and therefore appears to be eligible for listing on the National Register.

References (continued):

"Nobody Need Be Ashamed to Borrow From the Remedial Loan," SF Call, 22 Dec 1912.
Rinehart, Katherine J., "Petaluma: A History in Architecture," Arcadia Publishing, 2005.
San Francisco Provident, Our History, <http://www.sanfranciscoprovident.com/t-ourhistory.aspx>
Sanborn Fire Insurance Maps; 1913, 1949.
San Francisco City Directories.

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 1 of 1 Resource Name or # (Assigned by Recorder) 3704012

*Recorded by: Tim Kelley Consulting, LLC Date 3/8/2011

☒ Continuation ☐ Update

66 Mint Street may have been altered since the time of previous survey and documentation, which did not note any alterations. Currently, the entries feature anodized aluminum-frame double doors, which are obviously not original. Additionally, the entrance on the right side of the northeast facade does not feature a pedimented surround like the other entrances and is instead surmounted by a large multi-lite anodized aluminum-sash transom. Generally, the building retains integrity, however.

The building was previously evaluated on a DPR 523: Primary Record form and was thought to be potentially eligible for the National Register once more information is known about it. This status as "potentially eligible for the National Register" appears to still be appropriate based on additional research.



View of southeast and northeast facade.
103_4068.JPG 3/8/2011

View of southeast facade. 103_4068.JPG 3/8/2011

State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code 5S3
Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 2 *Resource name(s) or number (assigned by recorder) 3704013, 936-940 Mission Street

P1. Other Identifier Hotel Chronicle
*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad: _____

Date: _____

*c. Address: 936-940 Mission Street

City: San Francisco

Zip: _____

d. UTM: (Give more than one of large and/or linear resources) Zone _____; _____ mE/ _____ mN

e. Other Locational Data: Assessor's Parcel Number: 3704013

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

936-940 Mission Street is a five-story, rectangular-plan, brick masonry, Edwardian style SRO hotel and commercial building that is clad with brick and topped by a flat roof. The building occupies the entirety of its 7,997 square foot lot on the northwest side of Mission Street between Mint and 6th streets. The primary facade faces southeast onto Mission Street and the majority of the first story is boarded up, but appears to have featured two storefronts at one time. On the right side of the first story is the primary entrance to the hotel, which is slightly recessed and enclosed by a metal security gate. It features a fully-glazed, metal frame door and a large plate glass window over a low brick dado. The entry is surmounted by a flat canopy with rounded corners and a horizontally banded fascia. The first and second stories are separated by a dentiled intermediate cornice and frieze. The upper stories are fenestrated with a regular pattern of paired one-over-one, double-hung, wood-sash windows, with a single window of the same type at the center accessing a fire escape. The pairs of windows are separated by flat pilasters with decorative diamond-motif brickwork at the top, and spandrel panels between each story level that feature herringbone brickwork and diamond-shaped tiles. The fourth and fifth stories are separated by a band of anthemion molding and the facade terminates in a prominent dentiled and modillioned cornice. A metal blade sign reading "Chronicle Hotel" projects from the right side of the facade between the second and third stories. The secondary facades abut neighboring buildings and are not visible. The building appears to be in fair condition.

*P3b. Resource Attributes: (list attributes and codes) HP5. Hotel/motel

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of southeast facade.
103_4071.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both

1915, Assessor's Office

*P7. Owner and Address:

Patel Vallabh & Shantaben &
936 Mission St
San Francisco Ca
94103

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive



*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

- ☒ BSOR ☐ Photograph Record ☐ Sketch Map
☐ Archaeological Record ☐ NONE ☐ Location Map ☐ Continuation Sheet ☐ Other...
☐ Artifact Record ☐ District Record ☐ Linear Feature Record

BUILDING, STRUCTURE, AND OBJECT RECORD

*NRHP Status Code 5S3

Page 2 of 2 *Resource Name or # (Assigned by recorder) 3704013, 936-940 Mission Street

B1. Historic Name Land Hotel, Chronicle Hotel

B2. Common Name _____

B3. Original Use Hotel B4. Present Use: Apartments/Hotel

*B5. Architectural Style Edwardian

*B6. Construction History

Constructed 1915.

*B7. Moved? ☒ No ☐ Yes

Date? _____

Original Location: _____

*B8. Related Features None.

B9a. Architect Unknown

*B10. Significance: Theme Social and Cultural Area: _____
Development; Creating the New

Period of Significance 1870-1930 Property Type Hotel Applicable Criteria A, C

(Discuss importance in terms of historical or architectural context as defined by theme, period, and geographic scope. Also address integrity)

Although the architect of 936-940 Mission Street is unknown, the Edwardian hotel building was one of many residential hotels in the Mid-Market survey area serving both short-term guests and long-term residents who were also employed in the area, including laborers, clerks, and those employed in the nearby theaters and restaurants.

936-940 Mission Street retains integrity. Its original plan, massing, facade organization, materials and ornamentation are intact. The first story is boarded up concealing the state of the storefronts; however, visible contours suggest that the original openings are still intact, although the clerestory may have been infilled. Storefront alterations are a common and readily conceded alteration throughout the city, however. In general the building's original appearance is discernible.

B11. Additional Resource Attributes: (List attributes and codes) HP5. Hotel/motel

*B12. References: Sanborn maps, US Census, City Directories

(Sketch Map with north arrow required.)

B13. Remarks

*B14. Evaluator Tim Kelley Consulting

*Date of Evaluation 3/8/2011

(This space reserved for official comments)



PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code 5S3

Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 4 *Resource name(s) or number (assigned by recorder) 3704017, 948-952 Mission Street

P1. Other Identifier

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 948-952 Mission Street

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone ____; ____mE/ ____mN

e. Other Locational Data: Assessor's Parcel Number: 3704017

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

948-952 Mission Street is a four-story, rectangular-plan, brick masonry, Edwardian style hotel building that is clad with smooth stucco and topped by a flat roof. The building occupies the entirety of its 6,250 square foot lot on the northwest side of Mission Street between Mint and 6th streets. The primary facade faces southeast onto Mission Street and two storefronts dominate the majority of the first story. The storefronts consist of large plate glass display windows with recessed entrances adjacent to one another at the center of the facade. The entrances consist of fully-glazed double doors with transoms. The storefronts are surmounted by multi-lite, wood-sash clerestory windows. The hotel entrance is located on the right side of the first story and consists of a recessed vestibule that is enclosed by a metal security gate and surmounted by a flat hood with dentils and decorative brackets underneath. Above the hood is a lettered sign reading "Hotel." The first and second stories are separated by a molded intermediate cornice. The second story features seven, regularly-spaced, double-hung, aluminum-sash windows with transom lites. The window at the center of the facade is narrower than the others. The wall of the second story is adorned with incised horizontal lines and flat-arch voussoirs over the windows. The second and third stories are separated by a molded intermediate cornice. The third and fourth stories each features seven one-over-one, double-hung, wood-sash windows, with the window at the center of each story being narrower than the others. (continued)

*P3b. Resource Attributes: (list attributes and codes) HP5. Hotel/motel

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)



*P5b. Photo (view, date, accession #)
View of southeast facade.
103_4074.JPG 3/8/2011

*P6. Date Constructed/Age and Sources
☐ Historic ☐ Prehistoric ☐ Both
1907, Assessor's Office

*P7. Owner and Address:

Patel Devendra
948 Mission St
San Francisco Ca
94103

*P8. Recorded by
Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:
3/8/2011

*P10. Survey Type: (Describe)
Intensive

*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

- | | | |
|------------------------------------------------|-------------------------------------------------------|--------------------------------------------------------|
| <input checked="" type="checkbox"/> BSOR | <input checked="" type="checkbox"/> Photograph Record | <input type="checkbox"/> Sketch Map |
| <input type="checkbox"/> Archaeological Record | <input type="checkbox"/> NONE | <input checked="" type="checkbox"/> Continuation Sheet |
| <input type="checkbox"/> Artifact Record | <input type="checkbox"/> District Record | <input type="checkbox"/> Other... |
| <input type="checkbox"/> Linear Feature Record | | |

CONTINUATION SHEET

Page 2 of 4 Resource Name or # (Assigned by Recorder) 3704017, 948-952 Mission

*Recorded by: Tim Kelley Consulting

Date 3/8/2011

☒ Continuation ☐ Update

P3a: Description (continued)

The windows on the fourth story have segmental arch openings and have a simple surround that also includes the window on the story below. Above the fourth story windows, three segmental arched label moldings group the windows into three sections. The label moldings have decorative paneled corbels and keystones. The facade terminates in a plain frieze and a dentiled and molded cornice that is supported by decorative brackets.

The rear of the building faces northwest onto Jessie Street and consists of the rear of the four-story building, and a two-story addition on the southwest side of the rear of the lot. The four story portion features a flat wall plane pierced by segmental arch window openings with one-over-one, double-hung, wood-sash windows with solid tympanum panels at the top. The facade terminates in a flat, unadorned roofline. The addition is constructed of reinforced concrete and projects to the street. The northwest facade, facing Jessie Street, is clad with smooth stucco and features three bays on the first story containing a fully-glazed, metal-frame pedestrian door with sidelights in the left bay, a brick dado surmounted by a three-part window in the center bay, and a partially-glazed, double door in the right bay. The first and second stories are separated by a flat stuccoed beltcourse and a thinner stuccoed stringcourse runs under the second story windows. The windows on the second story consist of single-lite, fixed sashes with solid panels at the top of the opening. The facade terminates in a flat roofline adorned with a frieze bearing the alphabet in three-dimensional lettering spanning the facade. The northeast facade of the addition is clad with exposed board-form concrete and has two windows on the left side of the first story.

The secondary facades of the main building and the southwest facade of the addition abut adjacent buildings and are not visible. The building appears to be in good condition.

Page of 4 Resource Name or # (Assigned by Recorder) 3704017, 948-952 Mission

*Recorded by: Tim Kelley Consulting Date 3/8/2011

☒ Continuation ☐ Update Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



View of southeast and northeast facades.
103_4073.JPG 3/8/2011

BUILDING, STRUCTURE, AND OBJECT RECORD

*NRHP Status Code 5S3

Page 4 of 4 *Resource Name or # (Assigned by recorder) 3704017, 948-952 Mission Street

B1. Historic Name Pantages Hotel, Alkain Hotel

B2. Common Name None

B3. Original Use Hotel B4. Present Use: Hotel

*B5. Architectural Style Edwardian

*B6. Construction History
Constructed 1907.

*B7. Moved? ☒ No ☐ Yes

Date? _____

Original Location: _____

*B8. Related Features None.

B9a. Architect Philip Schwerdt

*B10. Significance: Theme Social and Cultural
Development; Creating the New

Area: _____

Period of Significance 1870-1930 Property Type Hotel Applicable Criteria A, C

(Discuss importance in terms of historical or architectural context as defined by theme, period, and geographic scope. Also address integrity)

948-952 Mission Street appears eligible for local listing under Criterion A (Events) because the building was one of many residential hotels in the Mid-Market survey area serving both short-term guests and long-term residents who were also employed in the area, including laborers, clerks, and those employed in the nearby theaters and restaurants. It also appears eligible for local listing under Criterion C (Design/Construction). Architect Philip Schwerdt is not a particularly well-known San Francisco architect; however, the former Pantages Hotel is an excellent and well-preserved example of this once-widespread building type.

948-952 Mission Street retains integrity. Its original plan, massing, facade organization, materials and ornamentation are intact. The storefront windows and doors have been replaced, but maintain the same openings and configurations, including the clerestory. In general the building's original appearance is discernible.

B11. Additional Resource Attributes: (List attributes and codes) HP5. Hotel/motel

*B12. References: Sanborn maps, US Census, City Directories

(Sketch Map with north arrow required.)

B13. Remarks

*B14. Evaluator Tim Kelley Consulting

*Date of Evaluation 3/8/2011

(This space reserved for official comments)



State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code 6Z

Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 3 *Resource name(s) or number (assigned by recorder) 3704018, 956-960 Mission Street

P1. Other Identifier

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 956-960 Mission Street

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone _____; _____ mE/ _____ mN

e. Other Locational Data: Assessor's Parcel Number: 3704018

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

956-960 Mission Street is a two-story, rectangular-plan, brick masonry, utilitarian style commercial building that is clad with smooth stucco and topped by a flat roof. The building occupies the entirety of its 11,857 square foot lot on the northwest side of Mission Street between Mint and 6th streets. The primary facade faces southeast onto Mission Street and the first story is divided into two structural bays, with each bay containing a storefront. The storefronts feature aluminum-sash plate glass display windows and are covered by metal accordion gates. The left storefront features a recessed pedestrian entrance surmounted by a fabric awning on the left side and a fully-glazed, metal-frame pedestrian door in a recessed vestibule with angled sides at the center. The storefront in the right bay features a recessed entrance on the right side containing two fully-glazed, metal-frame pedestrian doors with transoms. Slightly recessed rectangular wall panels surmount each bay. The second story features twelve narrow, slightly recessed windows, each with a sliding, aluminum sash on the bottom and a fixed single lite on the top. A flat, stuccoed stringcourse spans the facade above the windows and the facade terminates in a flat roofline with stucco coping. (continued)

*P3b. Resource Attributes: (list attributes and codes) HP6. 1-3 story commercial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of southeast facade.
103_4075.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both

1910, Assessor's Office

*P7. Owner and Address:

Chun-sun & Mora Lai Fmly Tr
Lai Chun Sun & Mora Li Trus
3824 Sacramento St
San Francisco Ca 94118

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive



*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

☒ BSOR ☐ Photograph Record ☐ Sketch Map
☐ Archaeological Record ☐ NONE ☐ Location Map ☒ Continuation Sheet ☐ Other...
☐ Artifact Record ☐ District Record ☐ Linear Feature Record

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 2 of 3

Resource Name or # (Assigned by Recorder) 3704018, 956-960 Mission

*Recorded by: Tim Kelley Consulting

Date 3/8/2011

☒ Continuation ☐ Update

P3a: Description (continued)

The rear facade faces northwest onto Jessie Street, is three-stories high, and clad with exposed structural brick. The first story features three vehicular/service entrances. The right and leftmost entrances have metal roll-up doors and are flanked by a flush wood pedestrian door to the left and right, respectively. The pedestrian doors have segmental arch openings. The center entrance has a hinged double door. To its left is an infilled segmental arch window opening. To its right are three similar window openings; two are infilled and one has a one-over-one, double-hung, wood-sash.

The second and third stories are fenestrated with segmental arch window openings. Many of the openings are infilled, while the rest feature a variety of window types, including sliding vinyl sashes with transom lites; one-over-one, double-hung, wood sashes; and two-over-two configurations with double casement sashes on the bottom and fixed lites on top. The facade terminates in a flat unadorned roofline. The secondary facades abut neighboring buildings and are not visible. The building appears to be in good condition.

BUILDING, STRUCTURE, AND OBJECT RECORD

Page 3 of 3 *NRHP Status Code 6Z
*Resource Name or # (Assigned by recorder) 3704018, 956-960 Mission Street

B1. Historic Name None
B2. Common Name None
B3. Original Use Commercial B4. Present Use: Commercial

* B5. Architectural Style NA

*B6. Construction History
Constructed 1910.

*B7. Moved? ☒ No ☐ Yes Date? _____ Original Location: _____

*B8. Related Features None.

B9a. Architect Walter J. Matthews

*B10. Significance: Theme NA Area: _____

Period of Significance NA Property Type Commercial Applicable Criteria NA

(Discuss importance in terms of historical or architectural context as defined by theme, period, and geographic scope. Also address integrity)

956-960 Mission Street is not associated with significant events or persons important to the survey area. In addition, although Walter J. Mathews was a prominent Oakland architect, best known for his residences in Oakland and for commercial and civic buildings in the East Bay, the building does not appear to be architecturally significant according to California Register criteria. The building does not embody the distinctive characteristics of a type, period, or method of construction, or possess high artistic value. Finally, 956-960 Mission Street lacks integrity. Its original plan and massing, and possibly its facade organization, appear to be intact, but materials have been altered and ornamentation has likely been stripped. The storefronts have been replaced (which is a common and readily conceded alteration throughout the city), the clerestory appears to have been infilled, and the second story windows have been replaced. The original fenestration pattern and cladding materials are unknown, but appear to have been the subject to alteration, while ornamentation - particularly a cornice - appears to have been removed. It is therefore not eligible for the California Register under any criteria.

B11. Additional Resource Attributes: (List attributes and codes) HP6. 1-3 story commercial building

*B12. References:

(Sketch Map with north arrow required.)

B13. Remarks

*B14. Evaluator Tim Kelley Consulting

*Date of Evaluation 3/8/2011

(This space reserved for official comments)



State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code _____

Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 1 *Resource name(s) or number (assigned by recorder) 966 Mission Street

P1. Other Identifier

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 966 Mission Street

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone ____; ____mE/ ____mN

e. Other Locational Data: Assessor's Parcel Number: 3704019

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

966 Mission Street is a two-story, rectangular-plan, brick or concrete, Classical Revival style commercial building that is clad with smooth stucco and topped by a flat roof. The building occupies the entirety of its 2,250 square foot lot on the northwest side of Mission Street between Mint and 6th streets. The primary facade faces southeast onto Mission Street and the base is clad with marble tile. The first story is dominated by a glazed, aluminum-frame storefront assembly that has a large central window flanked by fully-glazed pedestrian doors with sidelights. The storefront is surmounted by multi-lite, aluminum-sash clerestory windows. The second story features four multi-lite, aluminum, industrial sash windows. A stucco stringcourse runs below the windows and they are flanked by square pilasters. A narrow frieze adorned with rosette blocks and a simple cornice span the upper facade, which terminates in a peaked and tabbed parapet. The secondary facades abut neighboring buildings and are not visible. The building appears to be in excellent condition.

*P3b. Resource Attributes: (list attributes and codes) HP6. 1-3 story commercial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of southeast facade.
103_4076.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both
1922, Assessor's Office

*P7. Owner and Address:

Gurfinkel Trust
219 N Brand Blvd
Glendale Ca
91203

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive



*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

☐ Archaeological Record ☒ NONE ☐ BSOR ☐ Photograph Record ☐ Sketch Map
☐ Artifact Record ☐ District Record ☐ Location Map ☐ Continuation Sheet ☐ Other...
☐ Linear Feature Record

State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code 5S3
Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 2 *Resource name(s) or number (assigned by recorder) 3704020, 968 Mission Street

P1. Other Identifier

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 968 Mission Street

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone _____; _____ mE/ _____ mN

e. Other Locational Data: Assessor's Parcel Number: 3704020

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

968 Mission Street is a two-story, rectangular-plan, reinforced concrete, Art Deco style, commercial building that is clad with smooth stucco and topped by a flat roof. The building occupies the entirety of its 3,998 square foot lot on the northwest side of Mission Street between Mint and 6th streets. The primary facade faces southeast onto Mission Street and features a vehicular entrance at the center of the first story that has been infilled with a glazed, anodized aluminum-frame assembly that includes a set of double doors and is covered by a metal security gate. On the left side of the center entry is a pedestrian entrance with a flush metal door and a metal security gate. The door is surmounted by a small square window with metal security bars. To the right of the center entrance is a solid panel that may be an infilled doorway, but does not extend to the ground. It is surrounded by molded stucco trim and surmounted by a small square window with metal security bars. The opening of the central entry extends to the second story and a spandrel panel above the glazed assembly bears illuminated box signs. The second story features a large, multi-lite, steel-sash, industrial window within the dimensions of the extended entry opening. The facade terminates in a flat roofline with a square panel with chamfered corners at the center that projects above the roofline slightly and bears a bas relief depicting blind justice holding a set of scales. An illuminated blade sign projects from the left side of the second story. The secondary facades abut neighboring buildings and are not visible. The building appears to be in fair condition.

*P3b. Resource Attributes: (list attributes and codes) HP6. 1-3 story commercial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of southeast facade.
103_4077.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both

1930, Assessor's Office

*P7. Owner and Address:

Cheung Pak Siu & Yuk Yan W
% Pak Siu Cheung
851 Larch Ave
S San Fran Ca 94080

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive



*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

- ☒ BSOR ☐ Photograph Record ☐ Sketch Map
☐ Archaeological Record ☐ NONE ☐ Location Map ☐ Continuation Sheet ☐ Other...
☐ Artifact Record ☐ District Record ☐ Linear Feature Record

BUILDING, STRUCTURE, AND OBJECT RECORD

*NRHP Status Code 5S3

Page 2 of 2 *Resource Name or # (Assigned by recorder) 3704020, 968 Mission Street

B1. Historic Name Toledo Scale Co.

B2. Common Name none

B3. Original Use manufacturing B4. Present Use: commercial

* B5. Architectural Style Art Deco

*B6. Construction History

Constructed 1930.

*B7. Moved? ☒ No ☐ Yes Date? _____ Original Location: _____

*B8. Related Features None.

B9a. Architect unknown

*B10. Significance: Theme Physical Development of the Area; Depression and World War Area: _____

Period of Significance 1930-1945 Property Type Commercial Applicable Criteria C

(Discuss importance in terms of historical or architectural context as defined by theme, period, and geographic scope. Also address integrity)

968 Mission Street was one of a handful of infill projects constructed during the Depression. 968 Mission Street has integrity. Its original plan, massing, facade organization, materials and ornamentation are intact. A large opening on the first story of the primary facade, which likely served as a vehicular/service entrance, has been infilled with a glazed storefront assembly, but is transparent so that it still reads as a former entrance and maintains the pattern of openings on the facade. Likewise, a pedestrian entrance on the right side of the first story appears to have been infilled, but its molded stucco trim remains to uphold the pattern of openings on the facade. In general the building's original appearance is discernible.

B11. Additional Resource Attributes: (List attributes and codes) HP6. 1-3 story commercial building

*B12. References:

(Sketch Map with north arrow required.)

B13. Remarks

*B14. Evaluator Tim Kelley Consulting

*Date of Evaluation 3/8/2011

(This space reserved for official comments)



State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code _____

Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 3 *Resource name(s) or number (assigned by recorder) 972-976 Mission Street

P1. Other Identifier

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 972-976 Mission Street

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone ____; ____ mE/ ____ mN

e. Other Locational Data: Assessor's Parcel Number: 3704021

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

972-976 Mission Street is a five-story with mezzanine, rectangular-plan, reinforced concrete, Edwardian style commercial loft building that is clad with stucco and topped by a flat roof. The building occupies the entirety of its 12,000 square foot lot on the northwest side of Mission Street between Mint and 6th streets. The primary facade faces southeast onto Mission Street and is divided into three structural bays. On the first story the left bay features a metal-frame storefront assembly with solid panels at the bottom and plate glass at the top. The center bay features a similar assembly with a recessed entrance at the center that consists of double doors flanked by angled display windows and enclosed by a metal security gate. Both bays have multi-lite, aluminum-sash clerestory windows with fixed and operable portions that correspond to the mezzanine level. The rightmost bay of the first story contains the primary entrance. It has a pebble dash panel on the left and a glazed, aluminum-frame entry assembly on the right that includes a set of fully-glazed double doors. There are no clerestory windows in this bay. The first and second stories are separated by a flat stuccoed beltcourse. The second through fifth stories are also divided into three bays; each bay containing a bank of multi-lite, steel, industrial sash windows. Flat mullions separate the windows within each bay on the second story, while the stories above feature round, slender colonette pilasters that rise from the top of the second story windows to the headers of the fifth story windows and terminate in small capitals. (continued)

*P3b. Resource Attributes: (list attributes and codes) HP7. 3+ story commercial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of southeast facade.
103_4080.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both

1925, Assessor's Office

*P7. Owner and Address:

972 Mission Llc
972 - 976 Mission St
San Francisco Ca 94103

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive



*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

☐ Archaeological Record ☐ NONE ☒ Photograph Record ☐ Sketch Map
☐ Artifact Record ☐ District Record ☐ Location Map ☒ Continuation Sheet ☐ Other...
☐ Linear Feature Record

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 2 of 3

Resource Name or # (Assigned by Recorder) 972-976 Mission Street

*Recorded by: Tim Kelley Consulting

Date 3/8/2011

☒ Continuation ☐ Update

P3a: Description (continued)

A steel fire escape is mounted to the front of the left bay and spans the second through the fifth stories, with a ladder extending to the roof. The facade terminates in a flat roofline featuring a frieze adorned with square shield ornaments and a molded cornice.

The rear facade of the building faces northwest onto Jessie Street and is clad with exposed board-form concrete. The first story features two vehicular entrances at the center with metal roll-up doors surmounted by multi-lite, steel, industrial sash clerestory windows. Similar windows flank the vehicular entrances and a service entrance with a metal roll-up garage door is located on the left side of the first story. The second through fifth stories feature multi-lite, steel, industrial sash windows. The facade terminates in a flat, unadorned roofline. The northeast facade is partially visible. It is clad with exposed board-form concrete and is unfenestrated. The southwest facade abuts a neighboring building and is not visible. The building appears to be in good condition.

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 3 of 3 Resource Name or # (Assigned by Recorder) 972-976 Mission Street

*Recorded by: Tim Kelley Consulting Date 3/8/2011

☒ Continuation ☐ Update Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



View of southeast facade. 103_4079.JPG
3/8/2011

State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code _____

Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 3 *Resource name(s) or number (assigned by recorder) 980-984 Mission Street

P1. Other Identifier

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 980-984 Mission St

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone ____; ____ mE/ ____ mN

e. Other Locational Data: Assessor's Parcel Number: 3704022

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

980-984 Mission Street is a four-story with mezzanine, rectangular-plan, reinforced concrete, Edwardian style commercial building that is clad with stucco and topped by a flat roof. The building fills the entirety of its 7,997 square foot lot on the northwest side of Mission Street between Mint and 6th streets. The primary facade faces southeast onto Mission Street and is divided into four structural bays. The primary entrance is located in the left bay of the first story and is double-height, also occupying the mezzanine level. It is slightly recessed and consists of a glazed, aluminum-frame assembly incorporating a set of double doors. The three bays to the right are occupied by a storefront. The center of the three bays has a recessed entry with a set of fully-glazed, aluminum-frame double doors with sidelights and a transom. The entry is surmounted by a fabric awning. On either side, the bays are filled with multi-lite, aluminum-sash display windows. At the mezzanine level, the bays are filled with multi-lite, aluminum-sash window assemblies with casement sashes at the center. Above the mezzanine level is a decoratively molded intermediate cornice. The second through fourth floors feature multi-lite, steel, industrial sash windows. The rightmost windows on each story feature a narrow casement sash on the left side that extends below the sill; on the second story, this part of the window interrupts the intermediate cornice below. The facade terminates in a molded plaster cornice that features shield motifs and scrolled brackets. (continued)

*P3b. Resource Attributes: (list attributes and codes) HP7. 3+ story commercial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of southeast facade.
103_4081.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both

1924, Assessor's Office

*P7. Owner and Address:

Cfri/urban Mission Street L
% Urban Realty Co.inc.
364 Bush Street
San Francisco Ca 94109

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive



*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

- ☐ Archaeological Record ☐ BSOR ☒ Photograph Record ☐ Sketch Map
☐ Artifact Record ☐ NONE ☐ Location Map ☒ Continuation Sheet ☐ Other...
☐ District Record ☐ Linear Feature Record

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 2 of 3

Resource Name or # (Assigned by Recorder) 980-984 Mission Street

*Recorded by: Tim Kelley Consulting

Date 3/8/2011

☒ Continuation ☐ Update

P3a: Description (continued)

The rear facade faces northwest onto Jessie Street and is clad with exposed board-form concrete. The first story features a fully-glazed, aluminum-frame pedestrian door with a sidelight on the left side. Near the center of the first story are two vehicular entrances with metal roll-up doors, and on the right side of the first story is a horizontal band of three, single-lite, fixed, steel-sash windows. The mezzanine level features three multi-lite, aluminum, industrial sash windows. The upper stories feature multi-lite, steel, industrial sash windows. Some of these windows near the center of the facade are narrow, while the rightmost windows are like those on the primary facade and have a narrow casement sash on the left side that extends below the sill. The facade terminates in a flat, unadorned roofline. The secondary facades abut neighboring buildings and are not visible. The building appears to be in good condition.

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page of 3 Resource Name or # (Assigned by Recorder) 980-984 Mission Street

*Recorded by: Tim Kelley Consulting Date 3/8/2011

☒ Continuation ☐ Update Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



Detail of upper facade and cornice.
103_4082.JPG 3/8/2011



Detail of first story storefronts.
103_4083.JPG 3/8/2011

State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code _____

Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 3 *Resource name(s) or number (assigned by recorder) 481-483 Jessie Street

P1. Other Identifier 986 Mission Street
*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 481-483 Jessie St

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone ____; ____mE/ ____mN

e. Other Locational Data: Assessor's Parcel Number: 3704024

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

481-483 Jessie Street is a five-story with mezzanine, rectangular-plan, reinforced concrete, Edwardian style commercial building that is clad with stucco and topped by a flat roof. The building occupies the entirety of its 8,000 square foot lot on the southeast side of Jessie Street between Mint and 6th streets. The primary facade faces southeast onto Mission Street and is divided into two structural bays. The left bay of the first story features a storefront with a recessed entrance on the left side. The entrance features two fully-glazed, aluminum-frame pedestrian doors with a sidelight and transom. On the right is a large display window above a ceramic tile dado. The right bay is deeply recessed and enclosed by a metal security gate. It appears to contain at least one sliding, aluminum-sash window and a pedestrian door. The mezzanine level features large, single-lite, fixed windows irregularly interspersed with one-over-one, double-hung, wood-sash windows. The second through fifth stories feature banks of five, aluminum-sash windows in each bay. The windows consist of a double-hung sash over a fixed sash and are separated by wide mullions. Flat wall panels adorn the wall surfaces between each story level and the facade is framed by a projecting band of stucco trim. A steel fire escape is mounted at the center of the facade and spans the second through the fifth stories, with a ladder accessing the roof. The facade terminates in a parapet adorned with molded and modillioned cornice and a roundel with a lion's head at the center. (continued)

*P3b. Resource Attributes: (list attributes and codes) HP7. 3+ story commercial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of southeast facade.
103_4084.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both
1907, Assessor's Office

*P7. Owner and Address:

Ngon Mai Low Revoc Trust
2227 29th Ave
San Francisco Ca 94116

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive



*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

☐ BSOR ☒ Photograph Record ☐ Sketch Map
☐ Archaeological Record ☐ NONE ☐ Location Map ☒ Continuation Sheet ☐ Other...
☐ Artifact Record ☐ District Record ☐ Linear Feature Record

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 2 of 3

Resource Name or # (Assigned by Recorder) 481-483 Jessie Street

*Recorded by: Tim Kelley Consulting

Date 3/8/2011

☒ Continuation ☐ Update

P3a: Description (continued)

The rear facade faces northwest onto Jessie Street and is clad with stucco. The first story features two vehicular entrances with metal roll-up doors at the center and a pedestrian entrance covered by a metal security gate and surmounted by a sliding, vinyl-sash window with false muntins on the left. The upper stories are divided into two bays. The second story features banks of multi-lite windows in each bay that have fixed and operable portions and are separated by wide mullions.

The third through fifth stories feature banks of windows that consist of double-hung sashes over fixed sashes, also separated by wide mullions. On the left side of each story is an individual two-over-two, double-hung window. The facade terminates in a flat roofline adorned with a simple cornice. The upper portion of the southeast facade is visible, but is featureless. The northeast facade abuts a neighboring building and is not visible. The building appears to be in good condition.

Page	of 3	Resource Name or #	(Assigned by Recorder)	481-483 Jessie Street
*Recorded by:	Tim Kelley Consulting	Date	3/8/2011	

☒ Continuation ☐ Update Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



View of northwest facade. 103_4086.JPG
3/8/2011

PRIMARY RECORD

Primary # _____

HRI # _____

Trinomial _____

NRHP Status Code _____

1S

Other Listings _____

Local: Category I in Article 11

Review Code _____

Reviewer _____

Date _____

Page 1 of 2

*Resource name(s) or number (assigned by recorder) 3704034

P1. Other Identifier Haas Candy Factory/ McElroy

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad: _____

Date: _____

*c. Address: 54 Mint Street

City: San Francisco

Zip: 94103

d. UTM: (Give more than one of large and/or linear resources) Zone _____; _____ mE/ _____ mN

e. Other Locational Data: Assessor's Parcel Number: 3704034

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

This five-story warehouse is rectangular in plan, with retail commercial on the ground level and industrial commercial/offices above. The building is of brick construction and features ornamental brickwork separating the base from the upper floors, as string courses under windows, and at the cornice level. Windows are recessed and double-hung, with rectangular surrounds facing Jessie Street on the second through fourth floors, segmental arched surrounds on the second through fourth floors of the Mint Street facade, and semi-circular arched surrounds on the fifth floor of both elevations. Corbelled brick modillions provide the primary cornice articulation, with a prominent segmental arch curve on the Jessie Street facade. A tall brick parapet with low embattled corners adds extra height and drama. This building was designed in 1907 by William Curlett, the architect of the Phelan Building (760-84 Market Street) and several other notable downtown San Francisco buildings at this time. The Haas Candy Factory was commissioned by Robert McElroy and was the main candy making facility for Haas retail stores in the City for 21 years. It is designated the highest category of the Downtown Plan (Category I in Article 11 of the Planning Code). This building may become eligible for the National Register of Historic Places when more is known about the building and/or its importance within William Curlett's architectural career.

*P3b. Resource Attributes: (list attributes and codes) HP8. Industrial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

Jessie/Mint Street corner view,
looking
west

*P6. Date Constructed/Age and Sources

☒ Historic ☐ Prehistoric ☐ Both

1907 per San Francisco
Architectural Heritage
building file

*P7. Owner and Address:

Jessie Historic Properties
Martin Building Company
54 Mint St, 5th Floor
Sf, Ca 94103

*P8. Recorded by

Anne Bloomfield
2229 Webster Street
San Francisco, CA 94115

*P9. Date Recorded:

06/06/2001

*P10. Survey Type: (Describe)

*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

- | | | | |
|------------------------------------------------|------------------------------------------|-------------------------------------------------------|---------------------------------------------|
| <input type="checkbox"/> Archaeological Record | <input type="checkbox"/> BSOR | <input checked="" type="checkbox"/> Photograph Record | <input type="checkbox"/> Sketch Map |
| <input type="checkbox"/> Artifact Record | <input type="checkbox"/> NONE | <input type="checkbox"/> Location Map | <input type="checkbox"/> Continuation Sheet |
| | <input type="checkbox"/> District Record | <input type="checkbox"/> Linear Feature Record | <input type="checkbox"/> Other... |

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 2 of 2 Resource Name or # (Assigned by Recorder) 3704034

*Recorded by: Anne Bloomfield

Date 06/06/2001

☒ Continuation ☐ Update

Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



Jessie Street facade. 3/8/2011. 103_4051.
JPG



Mint Plaza facade. 3/8/2011. 103_4050.JPG

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 1 of 1 Resource Name or # (Assigned by Recorder) 3704034

*Recorded by: Tim Kelley Consulting, LLC Date 3/8/2011

☐ Continuation ☒ Update

54 Mint Street does not appear to have been altered since the time of previous survey and documentation, which did not note any alterations. A minor exception may be the two fully-glazed, entry doors on the northeast facade. The building generally retains integrity, however.

The building was evaluated on a DPR 523: Primary Record in 2001 and was thought to be potentially eligible for the National Register once more information was know about it. In 2001, the building was listed on the National Register of Historic Places for its significant architecture. Its listed status appears to still be appropriate as there has been no loss of integrity or change in its ability to convey its significance.



View of southeast facade. 103_4051.JPG 3/8/2011



View of northeast facade. 103_4050.JPG
3/3/2011

State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code _____

Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 3 *Resource name(s) or number (assigned by recorder) 439-441 Stevenson Street

P1. Other Identifier 440-444 Jessie Street
*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad: _____

Date: _____

*c. Address: 439-441 Stevenson Street

City: San Francisco

Zip: _____

d. UTM: (Give more than one of large and/or linear resources) Zone _____; _____ mE/ _____ mN

e. Other Locational Data: Assessor's Parcel Number: 3704035

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

439-441 Stevenson Street is a one-story, L-plan, reinforced concrete, Beaux Arts style commercial building that is clad with smooth stucco and topped by a flat roof. The building occupies the entirety of its 8,934 square foot lot on the southeast side of Stevenson Street between 5th and 6th streets. The property is a through-lot, however, and also fronts on Jessie Street, where the primary facade is located, facing southeast. The primary facade features a blind arcade of nine arches with Corinthian pilasters in between and tympanums adorned with molded plaster cartouches and garlands. The second arches in from the sides of the facade feature recessed entrances with flush metal double doors. The doors are surmounted by multi-lite, steel-sash transoms. The arches flanking the arches containing the entries feature large, steel, industrial-sash windows above stuccoed dados. Only two arches at the center of the facade are not fenestrated. The facade terminates in a flat, unadorned roofline.

The northwest facade, facing Stevenson Street, features a flush wood pedestrian door on the left side that is surmounted by a large multi-lite, steel-sash transom. At the center of the facade is a vehicular entrance with a paneled wood roll-up door and a large multi-lite, steel-sash transom. On the right side of the facade is a wider vehicular entrance with a glazed, metal frame, roll-up door, and a recessed pedestrian entrance with a flush metal door. A large multi-lite, steel-sash transom spans the tops of the vehicular entrance and pedestrian entrance. The facade terminates in a simple cornice. (continued)

*P3b. Resource Attributes: (list attributes and codes) HP6. 1-3 story commercial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of southwest and southeast facades. 103_4053.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both

1924, Assessor's Office

*P7. Owner and Address:

Chritton Family Bypass Trus
Sally V Chritton Trustee
1718 Comstock Dr
Walnut Creek Ca 94595

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive

*P11. Report Citation: (Cite survey report and other sources, or enter "none")

***Attachments**

- ☐ Archaeological Record ☐ BSOR ☒ Photograph Record ☐ Sketch Map
☐ Artifact Record ☐ NONE ☐ Location Map ☒ Continuation Sheet ☐ Other...
☐ District Record ☐ Linear Feature Record



CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 2 of 3

Resource Name or # (Assigned by Recorder) 439-441 Stevenson Street

*Recorded by: Tim Kelley Consulting

Date 3/8/2011

☒ Continuation ☐ Update

P3a: Description (continued)

The southwest facade is clad with exposed board-form concrete and is featureless. The northeast facade abuts a neighboring building and is not visible. The building appears to be in good condition.

Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting

View of southeast facade. 103_4052.JPG
3/8/2011

PRIMARY RECORD

Primary # _____

HRI # _____

Trinomial _____

NRHP Status Code

1S

Other Listings _____

Review Code _____

Reviewer _____

Date _____

Page 1 of 1

*Resource name(s) or number (assigned by recorder) 3704079

P1. Other Identifier Hale's Warehouse

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad: _____

Date: _____

*c. Address: 34 Fifth Street/410 Jessie

City: San Francisco

Zip: 94103

d. UTM: (Give more than one of large and/or linear resources) Zone _____; _____ mE/ _____ mN

e. Other Locational Data: Assessor's Parcel Number: 3704079

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

This ten-story warehouse is L-shaped in plan, containing a small amount of retail commercial at ground level, fronting on Fifth Street, with industrial and office space behind and above. The building is of reinforced concrete construction with stucco cladding, rusticated at the Fifth/Stevenson intersection and left relatively unarticulated on the rest of the facade. The projecting cornice features modillions, moldings, and decorative low-relief panels. Along with another warehouse built in 1924, this building (1926, George de Colmesnil) provided support space for the primary Hale Brothers store at 901 Market Street. Hale's Warehouse was listed in the National Register of Historic Places in 2001 as a boundary increase to the 1986 National Register listing of 901 Market Street.

*P3b. Resource Attributes: (list attributes and codes) HP8. Industrial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

Fifth/Stevenson Street corner
view, looking south

*P6. Date Constructed/Age and Sources

☒ Historic ☐ Prehistoric ☐ Both

1926

per San Francisco
Architectural Heritage

*P7. Owner and Address:

Fifth Historic Properties
54 Mint St, 5th Floor
San Francisco, Ca 94103

*P8. Recorded by

Anne Bloomfield
2229 Webster Street
San Francisco, CA 94115

*P9. Date Recorded:

06/06/2001

*P10. Survey Type: (Describe)

*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

☐ BSOR

☐ Photograph Record

☐ Sketch Map

☐ Archaeological Record ☒ NONE

☐ Location Map

☐ Continuation Sheet ☐ Other...

☐ Artifact Record

☐ District Record

☐ Linear Feature Record

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page of 1 Resource Name or # (Assigned by Recorder) 3704079

*Recorded by: Anne Bloomfield

Date 06/06/2001

☐ Continuation ☐ Update

Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



Fifth/Stevensen Street corner view, looking south. 103_4035.JPG. 3/8/2011



First story storefront. 103_4036.JPG.
3/8/2011

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 1 of 1 Resource Name or # (Assigned by Recorder) 3704079

*Recorded by: Tim Kelley Consulting, LLC Date 3/8/2011

☐ Continuation ☒ Update

34 5th Street/410 Jessie Street does not appear to have been altered since the time of previous survey and documentation, which did not note any alterations. It therefore has integrity.

The building was previously documented on a DPR 523: Primary Record, which did not list any existing historic designations, nor provide evaluation of the building's eligibility for designation.



View of northeast and northwest facades. 103_4035.JPG 3/8/2011



Detail of storefront. 103_4036.JPG 3/8/2011

State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code _____

Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 2 *Resource name(s) or number (assigned by recorder) 424 Jessie Street

P1. Other Identifier 10 Mint Plaza
*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 424 Jessie Street

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone ____; ____ mE/ ____ mN

e. Other Locational Data: Assessor's Parcel Number: 3704113

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

424 Jessie Street is a nine-story, rectangular-plan, utilitarian style commercial and multi-family residential building that is clad with smooth stucco and topped by a flat roof. The building fills the entirety of its 1,559 square foot lot on the northwest side of Jessie Street (aka Mint Plaza) southwest of 5th Street. The primary facade faces southeast onto Jessie Street and is two bays wide. The primary entrance is located in the left bay and consists of a fully-glazed, metal-frame door. To the right of the door is a wide metal panel and a large, multi-lite sidelight. The door is surmounted by a flat metal canopy. A large multi-lite clerestory window is located above the door and sidelight. The bay on the right is filled by a multi-lite, metal frame assembly that includes a set of double doors and a clerestory window. The left side of the upper facade is spanned by a metal fire escape. Each story features two large, multi-lite, metal, industrial sash windows. The facade terminates in a simple molded stucco cornice. The ninth story consists of a pent house that is set back from the front facade and has sliding glass doors that access a rooftop deck.

The southwest facade is visible above the second story level and is largely featureless, except for windows on the seventh and eighth stories. The northeast facade abuts a neighboring building and is not visible. The building appears to be in good condition.

*P3b. Resource Attributes: (list attributes and codes) HP3. Multiple family property

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of southeast facade.
103_4046.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both
2006, Assessor's Office

*P7. Owner and Address:

Mcnerney Patrick
54 Mint Street 5th Fl
San Francisco Ca 94103

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive



*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

☐ Archaeological Record ☐ NONE ☒ Photograph Record ☐ Sketch Map
☐ Artifact Record ☐ District Record ☐ Location Map ☐ Continuation Sheet ☐ Other...
☐ Linear Feature Record

Page of 2 Resource Name or # (Assigned by Recorder) 424 Jessie Street

***Recorded by:** Tim Kelley Consulting **Date** 3/8/2011

☒ Continuation ☐ Update Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



View of southwest and southeast facades.
103 4048.JPG 3/8/2011

State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code _____

Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 3 *Resource name(s) or number (assigned by recorder) 418 Jessie Street

P1. Other Identifier 6-8 Mint Plaza

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 418 Jessie Street

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone ____; ____ mE/ ____ mN

e. Other Locational Data: Assessor's Parcel Number: 3704144

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

418 Jessie Street is a nine-story, rectangular-plan, Contemporary style commercial and multi-family residential building that is clad with smooth stucco and topped by a flat roof. The building fills the entirety of its 4,728 square foot lot on the northwest side of Jessie Street (aka Mint Plaza) southwest of 5th Street. The primary facade faces southeast onto Jessie Street and features the primary entrance on the left side of the first story. The entry is recessed and the door is set on an angle. It consists of a metal door with a metal mesh panel at the center and a metal mesh transom panel above. The other angled side of the recessed vestibule is curved slightly and consists of a large multi-lite, metal-sash window fitted with glass or translucent panels containing an amber-colored flecked pattern. To the right of the entry vestibule is a tall, narrow window, also fitted with amber-flecked glass. The left side of the first story features two large openings containing glazed, aluminum-frame assemblies that each include a set of double doors. The second story features six pairs of five-lite, anodized aluminum-sash, casement windows with horizontal muntins. The majority of the third through eighth stories feature a regular fenestration pattern of multi-lite, steel-sash, industrial windows. A metal fire escape runs up the left side of the facade. The roofline above the eighth story consists of a simple molded stucco cornice. The right side of the facade is set back above the second story, creating a third-story deck surrounded by a glazed, metal-frame railing. (continued)

*P3b. Resource Attributes: (list attributes and codes) HP3. Multiple family property

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)



*P5b. Photo (view, date, accession #

View of southeast facade.
103_4043.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both

1900, Assessor's Office

*P7. Owner and Address:

418 Jessie Historic Propert
Martin Building Co Inc
54 Mint St 5th Fl
San Francisco Ca 94103

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive

*P11. Report Citation: (Cite survey report and other sources, or enter "none")

***Attachments**

- | | | | |
|------------------------------------------------|------------------------------------------|-------------------------------------------------------|--------------------------------------------------------|
| <input type="checkbox"/> Archaeological Record | <input type="checkbox"/> BSOR | <input checked="" type="checkbox"/> Photograph Record | <input type="checkbox"/> Sketch Map |
| <input type="checkbox"/> Artifact Record | <input type="checkbox"/> NONE | <input type="checkbox"/> Location Map | <input checked="" type="checkbox"/> Continuation Sheet |
| | <input type="checkbox"/> District Record | <input type="checkbox"/> Linear Feature Record | <input type="checkbox"/> Other... |

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 2 of 3

Resource Name or # (Assigned by Recorder) 418 Jessie Street

*Recorded by: Tim Kelley Consulting


Date 3/8/2011

☒ Continuation ☐ Update

P3a: Description (continued)

The left side wall of the set-back features a balcony with a metal and glass railing on each story. The right side of the facade above the second story features a smooth wall plane with a continuous vertical band of windows on the left side, extending from the deck to the ninth story level. At the ninth story, the left side of the facade is set back and has sliding glass doors that access a rooftop deck. The secondary facades of the building abut neighboring buildings and are not visible. The building appears to be in excellent condition.

Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



PRIMARY RECORD

Primary # _____

HRI # _____

Trinomial _____

NRHP Status Code

3S

Other Listings

Local: Category II in Article 11

Review Code _____

Reviewer _____

Date _____

Page 1 of 3

*Resource name(s) or number (assigned by recorder) 3725087

P1. Other Identifier

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 959-965 Mission Street

City: San Francisco

Zip: 94103

d. UTM: (Give more than one of large and/or linear resources) Zone ____; ____mE/ ____mN

e. Other Locational Data: Assessor's Parcel Number: 3725087

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

The historic California Casket Company Building is a seven-story, steel frame, brick curtain wall commercial building on the southeast, or south, side of Mission Street west of Eighth Street. Piers divide its facade into three bays of three recessed double-hung windows each, with recessed spandrels. The lower two stories and the top one are set off from the rest to form a three-part vertical composition. Windows in the "capital" portion of the building are spaced like those in the "shaft," but they have arched lintels with voussoir bands. The two floors of the "base" have more open glazing. The entry is centered and announced by columns at the center piers. Except for minor storefront changes, the building appears intact as to location, design, setting, materials, workmanship, feeling, and association.

*P3b. Resource Attributes: (list attributes and codes) HP7. 3+ story commercial building

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

Mission Street & side elevations
looking east

*P6. Date Constructed/Age and Sources

☒ Historic ☐ Prehistoric ☐ Both

1905-07, per Architect and
Engineer, Nov. 190530.

*P7. Owner and Address:

Lyn Sanjay Company
965 Mission Street, Suite 650
San Francisco, Ca 94103
P--private

*P8. Recorded by

Anne Bloomfield
2229 Webster Street
San Francisco, CA 94115

*P9. Date Recorded:

08/04/1997

*P10. Survey Type: (Describe)

*P11. Report Citation: (Cite survey report and other sources, or enter "none")

*Attachments

☒ BSOR

☐ Photograph Record

☐ Sketch Map

☐ Archaeological Record

☐ NONE

☐ Location Map

☒ Continuation Sheet ☐ Other...

☐ Artifact Record

☐ District Record

☐ Linear Feature Record

BUILDING, STRUCTURE, AND OBJECT RECORD

*NRHP Status Code 3S

Page 2 of 3

*Resource Name or # (Assigned by recorder) 3725087

B1. Historic Name California Casket Company

B2. Common Name _____

B3. Original Use Commercial

B4. Present Use: C-Commercial

*B5. Architectural Style Chicago Style

***B6. Construction History**

Construction nearly finished by the time of the 1906 earthquake & fire. Damaged more by quake than by fire. Repaired afterwards, especially rear wall. Minor changes to storefronts since then.

*B7. Moved? ☒ No ☐ Yes

Date? _____

Original Location: _____

*B8. Related Features none

B9a. Architect Albert Pissis

unknown

*B10. Significance: Theme Development of Mid-Market area

Area: San Francisco

Period of Significance 1870-1947

Property Type Large Commercial Bldgs

Applicable Criteria A

(Discuss importance in terms of historical or architectural context as defined by theme, period, and geographic scope. Also address integrity)

The California Casket Company Building appears eligible for the National Register of Historic Places at the local level of significance under Criterion C, architecture, because it embodies the distinctive characteristics of a type or method of construction, namely a relatively early example of steel frame construction with brick and sandstone walls. Though still under construction, it withstood the 1906 San Francisco earthquake with only minor damage: X-cracks in vaults on the first three floors, more cracks in the brick walls at the rear corners, and difficulties at the staircases and the elevator partitions. The fire was less severe here than elsewhere in the city, so that even some of the wood windows survived, although the fire caused the sandstone on the facade to spall. Since the steel skeleton was fireproofed with concrete, it withstood the testing very well, and its example helped teach engineers how best to protect steel. (continued)

B11. Additional Resource Attributes: (List attributes and codes) HP7. 3+ story commercial building

*B12. References: U S G S Bulletin 324, "The San Francisco Earthquake & Fire," 1907.
San Francisco Heritage, files.
San Francisco City Directories, 1901-1953

(Sketch Map with north arrow required.)

B13. Remarks

*B14. Evaluator Anne Bloomfield

*Date of Evaluation 08/04/1997

(This space reserved for official comments)

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 3 of 3

Resource Name or # (Assigned by Recorder) 3725087

*Recorded by: Anne Bloomfield

Date 08/04/1997

☒ Continuation ☐ Update

B10: Significance (continued)

Post-fire photos show the building standing lonely amid rubble. As an example of the Chicago style of architecture, the facade has the typical "column" organization, plus handsome ornament in limited areas at base and "capital." The architect was Albert Pissis, one of the region's outstanding practitioners, designer of the Hibernia Bank Building (349/3). He had a photo of the California Casket Building published in Architect & Engineer's 1909 portfolio of his work. California Casket, manufacturer and supplier to undertakers, occupied the building until 1946. The period of significance is 1905-1907, for the design and rebuilding. Significant dates are 1905, for the design, and 1906, for the earthquake and fire. The area of significance is architecture. The building retains integrity.

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page of 3 Resource Name or # (Assigned by Recorder) 3725087

*Recorded by: Anne Bloomfield

Date 08/04/1997

☒ Continuation ☐ Update

Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



Mission Street facade. 3/8/2011. 103_4094.
JPG



First story storefronts. 3/8/2011.
103_4095.JPG



Detail of upper facade. 3/8/2011. 103_4096.
JPG

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 1 of 1

Resource Name or # (Assigned by Recorder) 3725087

*Recorded by: Tim Kelley Consulting, LLC

Date 3/8/2011

☐ Continuation ☒ Update

959-965 Market Street does not appear to have been altered since the time of previous survey and documentation, which noted minor alterations to the storefronts (and presumably the clerestory windows). It therefore retains integrity.

The building was previously evaluated on a DPR 523: Building, Structure, Object Record and was determined to be eligible for the National Register based on its architectural merit. This status as "individually eligible for the National Register" appears to still be appropriate.



View of northwest facade. 103_4094.JPG, 3/8/2011



Detail of storefronts. 103_4095.JPG
3/8/2011



Detail of upper facade. 103_4096.JPG
3/8/2011

State of California The Resources Agency
Department of Parks and Recreation
PRIMARY RECORD

Primary # _____
HRI # _____
Trinomial _____
NRHP Status Code 6Z

Other Listings _____
Review Code _____ Reviewer _____ Date _____

Page 1 of 4 *Resource name(s) or number (assigned by recorder) 3725088, 951-957 Mission Street

P1. Other Identifier

*P2. Location: ☐ Not for Publication ☒ Unrestricted

*a. County: San Francisco

and P2b and P2c or P2d. Attach a Location Map as necessary.

*b. USGS 7.5' Quad:

Date:

*c. Address: 951-957 Mission St

City: San Francisco

Zip:

d. UTM: (Give more than one of large and/or linear resources) Zone ____; ____mE/ ____mN

e. Other Locational Data: Assessor's Parcel Number: 3725088

*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

951-957 Mission Street is a five-story with mezzanine, rectangular-plan, reinforced concrete, Edwardian/Postmodern style mixed-use (residential over commercial) building that is clad with scored stucco and topped by a flat roof. The building occupies the entirety of its 12,857.6 square foot lot on the southeast side of Mission Street between Mary and 6th streets. The primary facade faces northwest onto Mission Street and the first story and mezzanine levels are divided into four bays and have been remodeled in the Postmodern style. The bays have granite dados and are divided by square pilasters with two circular ornaments and an angled capital at the top. The first story and mezzanine levels are separated by bands of stone panels and the mezzanine level is topped by a frieze of stone panels and an intermediate cornice. The four bays each contain glazed, anodized aluminum-frame storefront assemblies. The second bay from the left is recessed and includes two sets of glass double doors. The band of stone panels above it is curved. The rightmost bay is slightly recessed and includes two, fully-glazed, aluminum-frame pedestrian doors. It also has a curved band of stone panels above. The mezzanine level of each bay has multi-lite, anodized aluminum-sash windows with fixed and hopper portions. The second through fifth stories are divided into eight bays. The bays on each side are narrower and feature small, one-over-one, double-hung, wood-sash windows. All of the other bays feature pairs of windows of the same type. A metal fire escape spans the right side of second through the fifth stories, with a ladder accessing the roof. The facade terminates in a prominent entablature featuring a paneled frieze with a circular motif, egg-and-dart molding, paired brackets and a modillioned cornice. (continued)

*P3b. Resource Attributes: (list attributes and codes) HP3. Multiple family property

P4. Resources Present: ☒ Building ☐ Structure ☐ Object ☐ Site ☐ District ☐ Element of District ☐ Other

P5a. Photograph or Drawing (Photograph required for buildings, structures, and objects)

*P5b. Photo (view, date, accession #

View of northwest facade.
103_4098.JPG 3/8/2011

*P6. Date Constructed/Age and Sources

☐ Historic ☐ Prehistoric ☐ Both

1916, Assessor's Office

*P7. Owner and Address:

951-957 Mission Street Ass0
2050 Ninth Avenue
San Francisco Ca
94123

*P8. Recorded by

Tim Kelley Consulting
2912 Diamond St. #330
San Francisco, CA 94131

*P9. Date Recorded:

3/8/2011

*P10. Survey Type: (Describe)

Intensive



*P11. Report Citation: (Cite survey report and other sources, or enter "none")

***Attachments**

- | | | |
|------------------------------------------------|-------------------------------------------------------|--------------------------------------------------------|
| <input checked="" type="checkbox"/> BSOR | <input checked="" type="checkbox"/> Photograph Record | <input type="checkbox"/> Sketch Map |
| <input type="checkbox"/> Archaeological Record | <input type="checkbox"/> NONE | <input checked="" type="checkbox"/> Continuation Sheet |
| <input type="checkbox"/> Artifact Record | <input type="checkbox"/> Location Map | <input type="checkbox"/> Other... |
| <input type="checkbox"/> District Record | <input type="checkbox"/> Linear Feature Record | |

CONTINUATION SHEET

Primary #
HRI #
Trinomial

Page 2 of 4

Resource Name or # (Assigned by Recorder) 3725088, 951-957 Mission

*Recorded by: Tim Kelley Consulting

Date 3/8/2011

☒ Continuation ☐ Update

P3a: Description (continued)

The rear facade faces southeast onto Minna Street and is clad with stucco. The first story features four recessed pedestrian entrances covered with metal security gates and a number of single-lite, fixed windows with very narrow transom lites and metal security bars.


A light well spans the second through fifth stories on the left side of the facade, which is otherwise fenestrated with one-over-one, double-hung, wood-sash windows. Each story also features two flush wood or metal pedestrian doors that access fire escapes. The facade terminates in a flat unadorned roofline.

The northeast facade faces a parking lot. Two deep, wide light wells alternate with three narrow, shallow light wells and interrupt the facade from the second story to the roofline. Within the light wells and on the left end of the facade are a variety of one-over-one, double-hung, wood sash windows. The facade terminates in a flat, unadorned roofline.

The northwest facade abuts a neighboring building and is not visible. The building appears to be in good condition.

Date 3/8/2011

Note: 1997 Photos no longer available, all photos by Tim Kelley Consulting



BUILDING, STRUCTURE, AND OBJECT RECORD

Page 4 of 4 *NRHP Status Code 6Z
*Resource Name or # (Assigned by recorder) 3725088, 951-957 Mission Street

B1. Historic Name Ford Apartments
B2. Common Name none
B3. Original Use Residential over commercial B4. Present Use: Apartments over commercial
*B5. Architectural Style Edwardian/Postmodern

*B6. Construction History
Constructed 1916. First story facade remodeled ca. 1990.

*B7. Moved? ☒ No ☐ Yes Date? _____ Original Location: _____

*B8. Related Features None.

B9a. Architect Unknown

*B10. Significance: Theme NA Area: _____

Period of Significance NA Property Type Residential over Applicable Criteria NA

(Discuss importance in terms of historical or architectural context as defined by theme, period, and geographic scope. Also address integrity)

923 Market Street is not associated with significant events or persons important to the survey area. In addition, the building does not appear to be architecturally significant according to California Register criteria. The building does not embody the distinctive characteristics of a type, period, or method of construction, or possess high artistic value, and does not appear to be the work of a master.

923 Market Street retains integrity. Its original plan, massing, and general facade organization appear to be intact. Its materials and ornamentation remain intact on the third through sixth stories, but have been altered on the first and second stories. These alterations maintain the organization of structural bays, storefronts and clerestory windows, but render them in a Postmodern aesthetic with non-original cladding, glazing and decorative details. The alteration of storefronts is common and readily conceded throughout the city, and the retention of the facade's original organization lends itself to integrity. In general the building's original appearance is discernible. Although the building retains integrity, it is not eligible for the California Register under any criteria.

B11. Additional Resource Attributes: (List attributes and codes) HP3. Multiple family property

*B12. References:

(Sketch Map with north arrow required.)

B13. Remarks

*B14. Evaluator Tim Kelley Consulting

*Date of Evaluation 3/8/2011

(This space reserved for official comments)

